2.08 Upgrade Advisory for Site Supervisor Small Format

Technical Bulletin

Site Supervisor Small Format Critical Security Update

Overview

All Customers using <u>Small Format</u> Site Supervisor versions <u>"SMF" 2.01 through 2.07</u>, please contact Emerson Customer Service to obtain a critical security updated Small Format Feature Set File prior to upgrading to firmware version 2.08 or higher.

To prevent loss of configuration, a critical security updated Small Format Feature Set File is required. Please contact Emerson Customer Service to receive the critical upgrade file **prior to installing 2.08**.

Affected Versions

Small Format ("SMF" or "SF") 2.01 Through 2.07

If "SMF" or "SF" 2.01 through 2.07 appears in the footer of the UI, you must contact Emerson Customer Service to receive a critical security update Feature Set File for Small Format prior to upgrading to 2.08.

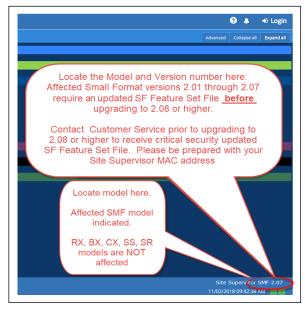


Figure 1



Who is Affected

All Small Format models using versions 2.01 through 2.07.

No other models are affected. Supervisor RX, BX, CX, SS and SR models are **NOT** affected. Any Site Supervisor that has been upgraded to RX, BX, CX, SS, or SR are **NOT** affected.

Upgrade Procedure

<u>CAUTION: Not following this procedure will result in loss of configuration.</u>

Follow these steps <u>before</u> upgrading to 2.08 or later:

- 1. On the Site Supervisor UI, identify the model and version number at the bottom right-hand corner (see *Figure 1*). If you see "**SMF"** and version number **2.01** through **2.07**, proceed to the next steps. If your model is RX, BX, CX, SS, SR, or if version **2.08** is already installed, no further steps are required.
- 2. Save a backup of the current configuration file.
- 3. Contact Emerson Customer Service.
- 4. Provide your Supervisor MAC address to receive the proper security updated Small Format Feature Set File to install before upgrading to 2.08.
- 5. From the File Management page, install the critical security updated Small Format Feature Set File provided by Customer Service and allow the Supervisor to restart. You will now be ready to update to version of 2.08 or higher with the latest security updates.

NOTE: You must install the security updated Small Format Feature Set File <u>before</u> upgrading to version 2.08 or higher.

Version 2.08 or the latest version can be downloaded from here:

https://climate.emerson.com/en-us/products/controls-monitoring-systems/facility-controls-electronics/facility-and-system-controls/site-supervisor-facility-control

Document Part # 026-4048 Rev 0

Page 2 of 2

This document may be photocopied for personal use.

Visit our website at http://www.emerson.com for the latest technical documentation and updates.

Join Emerson Technical Support on Facebook. http://on.fb.me/WUQRnt

For Technical Support call 770-425-2724 or email SolutionsTechSup@Emerson.com

The contents of this publication are presented for informational purposes only and they are not to be construed as warranties or guarantees, express or implied, regarding the products or services described herein or their use or applicability. Emerson Climate Technologies Retail Solutions, Inc. and/or its affiliates (collectively "Emerson"), reserves the right to modify the designs or specifications of such products at any time without notice. Emerson does not assume responsibility for the selection, use or maintenance of any product. Responsibility for proper selection, use and maintenance of any product remains solely with the purchaser and end-user.

026-4048 Emerson is a trademark of Emerson Electric Co. ©2019 Emerson Climate Technologies Retail Solutions, Inc. All rights reserved.